

## ARMORGARD 505 – K-505

<b>Description:</b>	Armorgard 505 is a 100 % solids, self-leveling, primerless, odorless epoxy form coating for precast, tilt-up, slip form or cast-in-place applications. Armorgard 505 is formulated to provide a hard, tough coating for wood and metal concrete forms. Use of Armorgard 505 transforms a “rough” form into a hard, smooth surface, creating an “architectural” quality cast. Armorgard 505 does not contain VOC’s or butyl glycidyl ether (BGE)*.		
<b>Product Advantages:</b>	<ul style="list-style-type: none"> <li>● EXTREMELY TOUGH SURFACE</li> <li>● SINGLE COAT APPLICATION</li> <li>● ADHESION TO WOOD, CONCRETE, STEEL</li> <li>● REDUCES FORM PREP TIME</li> <li>● STYRENE FREE</li> <li>● BONDS TO DAMP CONCRETE</li> </ul>		
<b>Application Guidelines:</b>	Normal application thickness is 20-30 mil (0.50-0.76 mm). Application varies depending on the porosity and roughness of the surface. A single build may be applied to horizontal surfaces up to 1/8" thick (125 mil or 0.3 cm).		
<b>Handling Properties:</b>	MIX RATIO, pbv (pbw)	2/1	(100/44.6)
	COLOR	Clear	
	MIXED VISCOSITY, cP or mPa.s	600	ASTM D 2196
	WORKING TIME, min	25	ASTM D 2393
	GEL TIME, min	30	ASTM D 2471
	(See the chart on the next page)		
	TACK-FREE TIME, h	5-6	
	INITIAL CURE, h	9-12	
	APPLICATION TEMPERATURE, °F (°C)		
	Ideal	70-80	(21-27)
	Acceptable	55-90	(13-32)
	COVERAGE* @ 20 mil (0.50 mm), ft <sup>2</sup> /gal	80	
	*Varies with porosity of surface		
<b>Physical Properties:</b>	HARDNESS, Shore D	82	ASTM D 2240
	MAXIMUM SERVICE TEMPERATURE, °F (°C)	135	(57)
	ADHESION, psi (MPa)		
	to steel	2,300	(15.9)
	to wood	>300	(2.1) (100% failure in wood)
	to concrete	>800	(5.5)(100% failure in concrete)
	COMPRSSSIVE STRENGTH psi (MPa)	12,000	(82.8) ASTM D 695
	TENSILE STRENGTH, psi (MPa)	6,100	(42.1) ASTM D 638
	ELONGATION @ BREAK, %	6	ASTM D 638
	Armorgard 505 will soften when exposed to extreme precast temperatures. A temperature of no greater than 135 °F (87 °C) is recommended when removing forms coated with Armorgard 505.		

\*Butyl Glycidyl Ether. The EPA (SARA Title III, section 312) lists it (BGE) as “Toxic” (per ANSI Z129.1) by skin absorption and an immediate health hazard.

**Surface Preparation:**

To achieve excellent adhesion, the substrate must be free of all loose and foreign material and should be clean. Oils, grease, waxes or other contaminants must be removed prior to coating. These can be removed with a solvent wipe using isopropyl alcohol or acetone or an application of warm (120-140 °F) caustic detergent followed by a hot water rinse. Repeat this procedure until the water does not "bead up" on the form. Armorgard 505 will not bond to a contaminated surface.

Relative humidity and dew point must be determined before application to avoid adhesion failures. The dew point is used to predict the substrate temperature at which air begins to condense, in the form of water, on the substrate. Never apply a coating unless the form surface temperature is 5 °F (2.5 °C) above the dew point. This temperature difference must be observed until the epoxy coating is cured to a tack-free state. A dew point calculation chart is available from a Copps Technical Representative


**Mixing:**

The storage temperature of Armorgard 505 will greatly affect the ease of mixing, application and curing time. For best results, Armorgard should be stored at **(50-70 °F or 10-22 °C)** for at least 24 hours before use. Mix 2 parts A (resin) to 1 part B (hardener) for 3 minutes using a Jiffy Mixer and a slow speed drill. Mix at slow speed (less than 500 rpm) to avoid air entrapment. **DO NOT** mix more material than can be used within the stated working time. **REMEMBER** - you will have less working time at higher temperatures.

**Application:**

Armorgard 505 can be applied with a squeegee, brush, non-shedding roller or a grooved fiberglass roller. Re-coating a used form requires a light sanding to remove concrete residue and improve surface profile and adhesion. **DO NOT "OVERWORK" MATERIAL.**

Below chart illustrates differences in cure speed between Armorgard 505 and Armorgard 505LT in relation to temperature.

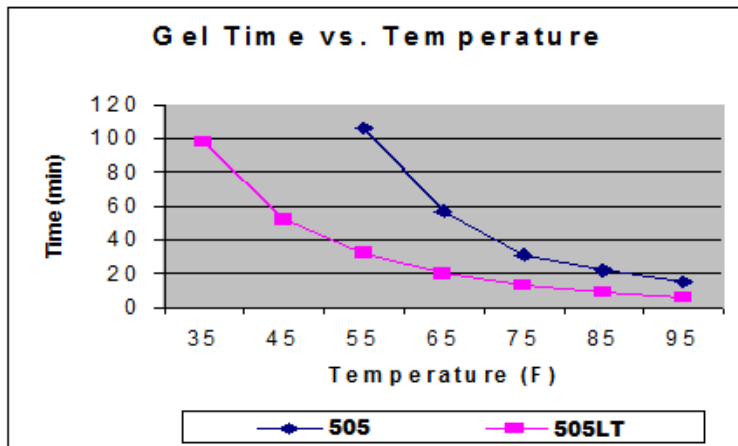

**SAFETY PRECAUTIONS**

Mix and pour in a well-ventilated area. Avoid contact with skin and eyes. If contact does occur, wash skin with soap and water and seek medical help. Read and understand all CAUTIONS on container labels and safety data sheets before using this material.

Avoid breathing of vapors. Forced local exhaust is recommended to effectively minimize exposure. NIOSH approved, organic vapor respirators and forced exhaust are recommended in confined areas, or when conditions (such as heated polymers, sanding) may cause high vapor concentrations. **DO NOT WELD ON, BURN OR TORCH ON OR NEAR, ANY EPOXY MATERIAL. HAZARDOUS VAPOR IS RELEASED WHEN AN EPOXY IS BURNED.**

**FOR INDUSTRIAL USE ONLY**

**WARRANTY AND DISCLAIMER**

Copps Industries, Inc. gives no warranty, express or implied, and all products are sold upon condition that purchasers will make their own tests to determine the quality and suitability of the product. Copps Industries, Inc. shall be in no way responsible for the proper use and service of the product. The information given in this publication is considered to be accurate and reliable and is provided as a service only. Physical properties shown are typical. Actual properties are dependent on curing conditions and degree of cure. Any information or suggestions given are without warranty of any kind and purchasers are solely responsible for any loss arising from the use of such information or suggestions. No information or suggestions given by us shall be deemed to be a recommendation to use any product in conflict with any existing patent rights.